


TABLE-GAUGE.XY

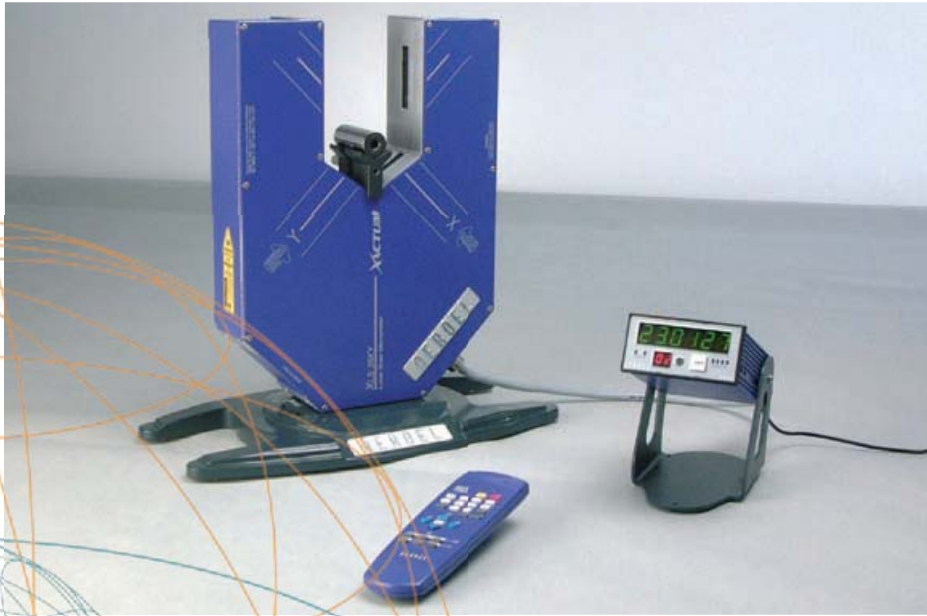

Use the Xactum Intelligent Laser Gauges as bench-top micrometers, in the Table-Gauge configuration: with no other instrument can you measure diameters so quickly, so accurately and so easily.

It's the ideal instrument to check wire samples, optical fibers and magnet wire.

No matter what the operators' skill level!

Ultra-accurate and perfectly reproducible measurements, thanks to an outstanding Laser Technology offered at affordable conditions.

The Table-Gauge.XY

The XLS gauges are programmed with a dedicated software and are completed with a display unit, a remote control, some fixturing to hold the part and a base-plate for bench-top use: using this "Table-Gauge" assembly you can rapidly check the diameter and the ovality of a number of different products, to an accuracy that previously could only be obtained in a metrology lab, using much more expensive equipment with specialized personnel.




System Configuration

The Table Gauge X system is composed by:

- a dual axis Xactum gauge, XLS13XY or XLS35XY type
- Table-Gauge.XY software pre loaded in the gauge
- DM-100 multi-colour LED display
- universal power supply
- I.R. Remote Control
- bracket to hold the display
- base plate for the gauge

Some optional accessories are available:

- V blocks to hold the sample
- hand driven rotating fixture (for the XLS13XY only)
- foot switch
- Hand-held programming terminal
- GageXcom software for PC communication.

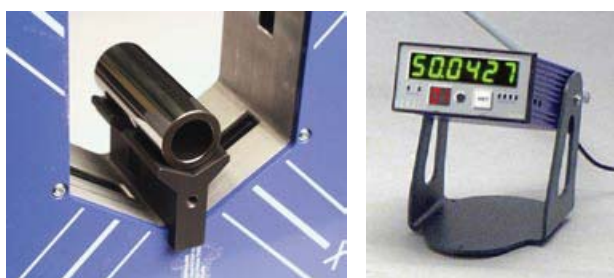

Exclusive Aeroel features



- The scanning motor based on the **Fluid Dynamic Bearing technology**, without ball bearing ⁽¹⁾ works perfectly, with no wear.
- **The NO-VAR option** allows you to automatically compensate for the expansion of the part when room temperature changes. The user only needs to program the proper coefficient of thermal expansion of the part.
- **The Web Server** allows you to connect the sensor through the Ethernet line to any Internet browser and "see it" as a website, where you can view the measures, set-up and program the gauge and even display the video signal (light pulse).



Types of measurements

It measures the diameters **Dx and Dy** along two crossed axes and the position **Cx and Cy** of the Center of the section, from the Center of the measuring field. The product can be **opaque or transparent**.



The measuring time (or the measuring frequency) can be set by programming the number of scans being averaged to get the required repeatability and resolution. ⁽²⁾

Single face scanning: in all measurement modes, you can use 1 mirror face only, to cancel the side dither of the scanning plane: when this option is selected, the scanning rate is reduced to 120 Hz or 75 Hz.

Measuring modes



Free-running diameter measurement along two axes at 90°: put the part on the fixture and you will display the diameters and the ovality.

Selecting the **Auto-sync mode**, you will get one measurement only, triggered just after having positioned the sample and after a programmable delay. The display will maintain the measurement after you have removed the part.

On-command measurement: you will get the Average, Maximum and Minimum diameters and their difference (Dmax-Dmin): by rotating the sample during the measurement you will get the real value of the product ovality. The Start/Stop command can be remote (Ethernet/RS232) or local by using the remote control the display SET key or a digital input line. By connecting a foot switch you can have the hands free to handle the part.

Display and remote control



Multicolor LED display to show the measured values and to allow system programming through the IR remote control.

The measured and programmed data can

be scrolled on the display by using the remote control or the SET key on the display panel.

It is possible to save in memory, in a **Product Library**, up to 1000 different sets of programmed parameters, for each specific part to be checked.

The display color will change corresponding to the tolerance status of the shown variable (**green, orange or red**).

The display unit includes **4 programmable alarm output lines** to drive additional external devices.

Simple and quick **programming using the remote control** keys and the messages on the display.

Offset function for user re-mastering.


Selectable Measuring Units inch/mm and Resolution (to 0.01µm / 1x10⁻⁶ inch).⁽³⁾



PC interface

An **external/remote computer** can be connected to the system through the **Ethernet/RS232** interface, to **program the system or to get the measured data**.

The **Web Server** allows you to connect the sensor through the Ethernet line to any Internet browser and "see it" as a website

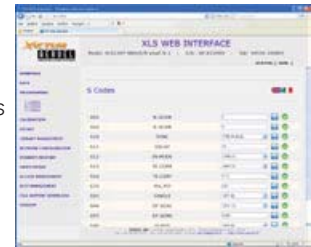

It is possible to use the RS232 port in VT100 emulation mode, which makes it possible the connection of the system to a PC using the **Windows⁽⁴⁾ Hyperterminal** program or to a hand-held programming terminal.



Using the optional **GageXcom software** provided by Aeroel, you can use **Excel⁽⁴⁾** spreadsheets to set-up the system and to get all measured results: you can write your own applications by writing

suitable Excel Macros and using standard Excel functions to process data.

(1) Available only on the 480 Hz scanners.

(2) The minimum averaging scan number is preset to 4 in the 480 Hz gauges and to 16 in the 1200 Hz gauges; the maximum measuring frequency is respectively 120 Hz or 75 Hz. The measuring repeatability can be computed by dividing the single shot repeatability (see the gauge data sheet) by the square root of the averaging scan number.

(3) Due to the display limitations, the 6 most significant digits only are shown; the full resolution is anyway available using the serial output ports.


(4) Windows and Excel are registered trademarks of Microsoft Corporation

Technical characteristics


XLS13XY/480



XLS13XY/1200

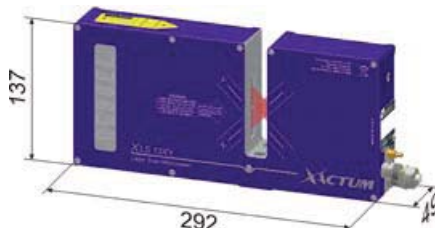

XLS35XY

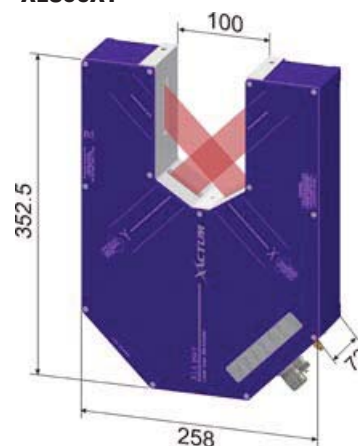

All dimensions are in mm.



DISPLAY AND ALARMS MODULE DM-100

- Main Display LED** 6 digits, 7 segments multicolour
- Sub Display LED** 2 digit
- 6 Warning lights** for the Status of the Inputs and the Outputs
- 4 Outputs** protected PNP, I_{max}: 100 mA
- 2 Inputs** PNP, I_{typ.}: 15 mA
- Dimensions:** 97 x 49 x 158 mm
- Weight:** 0.5 kg
- Power supply:** 24 VDC 150 mA




I.R. REMOTE CONTROL

- Size:** 140 x 55 x 25 mm
- Weight:** 67 g (without batteries)
- Power supply:** 2 AAA 1.5 V batteries

Available models

	TABLE-GAUGE.XY13		TABLE-GAUGE.XY35
Gauge Model	XLS13XY		XLS35XY
Beam height (mm)	13 x 13	4 x 4	35 x 35
Measurement range (mm)	From 0.1 to 10	From 0.03 to 3	From 0.2 to 32
Scanning rate (Hz)	2 x 480 / 2 x 1200		
Resolution (µm)	0.01 at best		
Repeatability (µm)	± 0.02 at best		± 0.15 at best
Linearity (µm)	± 0.5 at best		± 1 at best

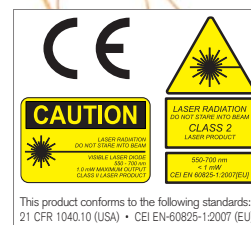

Specifications subject to change without notice. For additional details and complete specifications please see the gauge data sheet.



AEROEL S.R.L.
Via Pier Paolo Pasolini 35/3
Pradamano (UD)
33040 - ITALY
Phone +39 0432 671301
Fax +39 0432 671543
e-mail: aeroel@aeroel.it
<http://www.aeroel.it>



ISO 9001:2008